

Date: 8-May-2017

TAX INVOICE

No: 103858

Inv To: JACK TAN
2 Hilda Tce.
Hawthorn
SA
5062Deliver To: JACK TAN
2 Hilda Tce.
Hawthorn
SA
5062

Cust No: 100193 Mobile:0433 177 268 jacktango09@gmail.com

, Our Ref: DEL:100922

Reference:	Description:	Loc:	Qty:	Unit Inc:	GST	Total Inc:
-J101286	EVINRUDE F175DCXINF Ref No: IV230S Year: 2011 Hours: 2222 Serial No: 05327363 Labour (Per Hour) Trim ram end cap leaking Prime oil system Check water flow Connected laptop & primed oil system, printed engine fault & run history. Engine is set to run on XD30 XD50 engine oil, do not use XD100 unless settings are changed. Motor was not pumping water, removed gearbox & inspected water pump, Found water pump housing not sealing to base plate as it was warped, replaced water pump housing & re installed gearbox, ran motor now pumping water. Removed trim ram & end cap, replaced seals in end cap & re installed, filled trim pump with oil, found ram to be still leaking. Ram has pitting on crome shaft & needs to be addressed. Battery in boat flat.		3.50	115.00	36.59	402.52
395073	Water Pump Kit Complete V4 V6	20	1	108.90	9.90	108.90
CDS	Evinrude Computer Diagnostic		1	33.00	3.00	33.00
53-895304	Ring retainer		1	4.00	0.36	4.00
MISC	Seals		1	15.00	1.36	15.00
92-802880Q1	Power Trim & Steering Fluid 236 MI	<dfi>	1	11.95	1.09	11.95
CONSUM	Workshop consumables & disposal		1	10.00	0.91	10.00

Operator: DENNIS

Net: 532.14

GST 53.21

TOTAL: 585.35

Our service department is more than happy to assist you with any servicing issues. Thank you for your business!