

KI MOTOR CO.

ARC ✓ REF NO: AU25626

CASH01

Bill To
Cash Sale

P S and L M Coleby Trading as
KI Motor Co.
ABN 77 031 862 854
16 Telegraph Road
Kingscote, S.A. 5223
PH: (08) 8553 2021
FAX: (08) 8553 2129

Tax Invoice

Invoice Date

173827

5/05/2015
XXX

Job No
70440

Terms
C.O.D.

Order No
HORSFALL

Registrati CASH01

Make	Model	Engine	Chassis	Colour
GENERAL WORK				

Stock Code	Description-Text	Qty	Unit Price	Amount
TOYOTA LANDCRUISER				
REGO: WAA 561				
SPEEDO: 317,212				
VIN: JT731PJ7508528757				
Z334	OIL FILTER	1.00	25.45 Each	25.45
FMX MAGNATEC 15W40	FMX MAGNATEC 15W40 1LT.	9.50	7.86 EACH	74.71
SUMP PLUG WASHER	SUMP PLUG WASHER	1.00	1.82 Each	1.82
	ENVIRONMENTAL LEVY	1.00	3.64	3.64
	WORKSHOP SUPPLIES	1.00	7.27	7.27
	LABOUR JC			90.91

CARRIED OUT SERVICE AND CHECK OVER.
CHANGED ENGINE OIL AND FILTER.
CHECKED ALL LIGHTS, FLUID LEVELS, TYRES AND BRAKES.
CHECKED SUSPENSION ALL ROUND.
REPLACED SPOT LIGHT SWITCH (SUPPLIED).


** ADDITIONAL WORK REQUIRED **

ROCKER COVER GASKET LEAKING
GEARBOX HAS INTERNAL FAULT
REAR MAIN ENGINE SEAL LEAK
FRONT SHOCK ABSORBERS WORN
FRONT DRIVESHAFT WORN
GEARBOX MOUNT WORN

All goods are to remain the property of P.S. & L.M. Coleby
until paid for. P.S. & L.M. Coleby reserves the right
to retake possession of goods at any time prior to payment.

EFT Banking Details Name ANZ
BSB / Account 015-600 574264638

Balance

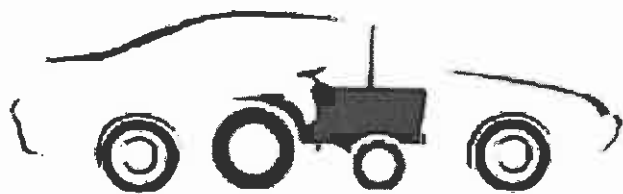

KI MOTOR CO.

ARC ✓ REF NO: AU25626

CASH01

Bill To
Cash Sale

P S and L M Coleby Trading as
KI Motor Co.
ABN 77 031 862 854
16 Telegraph Road
Kingscote, S.A. 5223
PH: (08) 8553 2021
FAX: (08) 8553 2129

Tax Invoice

Invoice Date

173827

5/05/2015
XXX

Job No
70440

Terms
C.O.D.

Order No
HORSFALL

Registrati CASH01

Make	Model	Engine	Chassis	Colour
GENERAL WORK				

Stock Code	Description-Text	Qty	Unit Price	Amount
------------	------------------	-----	------------	--------

ENGINE MOUNTS WORN
TIMING BELT DUE FOR REPLACEMENT
RECOMMEND COOLANT CHANGE
SPOT LIGHTS REQUIRE RE-WIRING

All goods are to remain the property of P.S. & L.M. Coleby until paid for. P.S. & L.M. Coleby reserves the right to retake possession of goods at any time prior to payment.

EFT Banking Details Name ANZ
BSB / Account 015-600 574264638

Subtotal	203.80
Rounding Amount	.02
Add GST	20.38
Total	224.20
Account Balance	224.20



KI MOTOR CO.

ARC ✓ REF NO: AU25626

CASH01

Bill To
Cash Sale

P S and L M Coleby Trading as
KI Motor Co.
ABN 77 031 862 854
16 Telegraph Road
Kingscote, S.A. 5223
PH: (08) 8553 2021
FAX: (08) 8553 2129

Tax Invoice

Invoice Date

174076

19/05/2015
XXX

Job No 70621	Terms C.O.D.	Order No HORSFALL	Registrati CASH01		
Make GENERAL WORK	Model	Engine	Chassis	Colour	
Stock Code	Description-Text	Qty	Unit Price	Amount	

TOYOTA LANDCRUISER

REGO. WAA 561

SPEEDO: 317,377

VIN: JT731PJ7508528757

RCG194	ROCKER COVER GASKET	1.00	20.00 EACH	20.00
KTBA083	TIMING BELT KIT	1.00	168.18 EACH	168.18
74310-60250-A0	RH SUNVISOR	1.00	100.00 EACH	100.00
74348-12020-18	VISOR HOLDER	1.00	8.18 Each	8.18
	WORKSHOP SUPPLIES	1.00	7.27	7.27
	LABOUR PC			227.27

ALL
DONE

REMOVED TIMING BELT COVER.

SET ENGINE TIMING.

REMOVED AND REPLACED TIMING BELT AND TENSIONER.

REFITTED TIMING COVER.

REMOVED AIR INTAKE TUBE.

REMOVED ROCKER COVER.

CLEANED GASKET SURFACES.

FITTED NEW ROCKER COVER GASKET.

REFITTED AND SECURED ROCKER COVER.


REFITTED AIR INTAKE TUBE.

REMOVED AND REPLACED RH SUNVISOR.

All goods are to remain the property of P.S. & L.M. Coleby until paid for. P.S. & L.M. Coleby reserves the right to retake possession of goods at any time prior to payment.

EFT Banking Details Name ANZ
BSB / Account 015-600 574264638

Subtotal	530.90
Add GST	53.10
Total	584.00
Account Balance	584.00

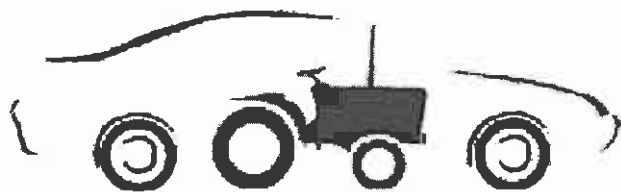

KI MOTOR CO.

ARC ✓ REF NO: AU36011

CASH01

Bill To
Cash Sale

P S and L M Coleby Trading as
KI Motor Co.
ABN 77 031 862 854
87 Playford Highway
Kingscote, S.A. 5223
PH: (08) 8553 2021
FAX: (08) 8553 2129

Tax Invoice

Invoice Date

175206

28/07/2015
XXX

Job No 71289 Terms C.O.D. Order No HORSFALL Registrati CASH01

Make	Model	Engine	Chassis	Colour
GENERAL WORK				
Stock Code	Description-Text	Qty	Unit Price	Amount

TOYOTA LANDCRUISER

REGO: WAA561

SPEEDO: 317566

VIN: JT731PJ7508528757

74320-90K04-08	LH SUNVISOR	1.00	104.55 EACH	104.55
74348-12020-18	VISOR HOLDER	1.00	8.18 Each	8.18
SHHM6060202-1	SS316 SET SCR IOS M6X20	1.00	0.27 EACH	0.27
90363-15017	SPIGOT BEARING	1.00	48.55 Each	48.55
0000039787	SECOND HAND GEARBOX/TRANSFER	1.00	2,315.45 EACH	2,315.45
R1082N	CLUTCH KIT	1.00	295.45 Each	295.45
	FREIGHT VIA KI FREIGHT	1.00	138.18	138.18
MULTITRAX OIL	MULTITRAX OIL 1L	3.00	9.73 Each	29.18
	WORKSHOP SUPPLIES	1.00	6.55	6.55
	LABOUR KH			545.45

REMOVEV AND REPLACE SUNVISOR

REPAIR DRIVING LIGHT OPERATION

REMOVE GEARBOX AND ASSOCIATED COMPONENTS, REMOVE AND

REPLACE CLUTCH KIT INCLUDING THRUST BEARING AND SPIGOT

FITTED UP GEARBOX AND SECURED ALL POINTS

FILL LEVELS AND ROAD TEST

All goods are to remain the property of P.S. & L.M. Coleby until paid for. P.S. & L.M. Coleby reserves the right to retake possession of goods at any time prior to payment.

EFT Banking Details Name ANZ
BSB / Account 015-600 574264638

Subtotal	3,491.81
Add GST	349.19
Total	3,841.00
Account Balance	3,841.00



Ph 08 8553 2021 - Fax 08 8553 2129
16 Telegraph Road, Kingscote SA 5223
Email: kimotorco@bigpond.com



Customer: GIL HORSFALL
Make/Model: TOYOTA LANDCRUISER HZJ75
Engine Size: 1HZ - 4.2L DIESEL
VIN: JT731PJ7508528757

Ph: _____
Year: 12-1994
Rego: WAA 561
Odometer: 317,212

Pre-Engine Checks

1. Check Timing Belt Replacement Interval* DONE			
2. Check for damage to bodywork, lamps and trims			
3. Check condition and operation of all seat belts			
4. Check operation of interior and exterior lights			
5. Check operation of ABS and air bag warning lights*			
6. Check air conditioning operation*			X
7. Check windscreen washers and wipers			
8. Check horn			
9. Lubricate all door hinges, locks and bonnet catches			
10. Check fuel cap			

Under the Bonnet

11. Check coolant condition			
12. Check brake fluid condition			
13. Check drive belts - ADJUSTED A/C.			
14. Check power steering operation & fluid condition			
15. Check battery			
16. Replace air filter* DONE (CLEANED)			
17. Replace spark plugs*			
18. Replace fuel filter*			
19. Replace pollen filter*			

Vehicle Raised

20. Change oil, filter and sump plug washer			
21. Check fuel lines and brake pipes			
22. Check condition & security of exhaust			
23. Check axle and transfer box oil levels*			
24. Check gearbox oil level*			
25. Check all steering and suspension joints			X
26. Check front tyre condition			
27. Check rear tyre condition			
28. Check front wheel bearing play			
29. Check rear wheel bearing play			
30. Check CV driveshaft and boot condition			
31. Check clutch cable/cylinder condition*			
32. Grease all greasing points*			
33. Check front brake condition			
34. Check rear brake condition			
35. Check handbrake operation			

Vehicle Lowered

36. Fill engine with specified grade oil			
37. Torque wheel nuts/studs			

To Finish

38. Reset service interval indicator*			
39. Stamp service book			
40. Replace service interval sticker			
41. Road test and re-check oil			

Comments:

DONE
- ROCKER COVER GASKET IS LEAKING
- # GEARBOX HAS MAJOR INTERNAL FAULT (VARIOUS GEAR OIL SEVERELY CONTAMINATED BY METAL)
- REAR MAIN SEAL IS LEAKING
- FRONT SHOCKERS ARE WORN
- FRONT DRIVESHAFT IS WORN
- GEAR BOX MOUNT IS WORN
- ENGINE MOUNTS ARE WORN
- TURNING BELT IS DUE FOR REPLACEMENT **DONE**
- RECOMMEND COOLANT CHANGE

Technician: J. COLERY

Signature: [Signature]

Date: 5/5/15

☒ Done

☒ Requires Attention

☐ Not Applicable

* Where Applicable

Checked

Future Attention Required

Immediate Attention Required